

No. : SHCCM160200536

Date: Mar. 11, 2016

Page: 1 of 6

The following sample(s) was/ were submitted and identified on behalf of the client as:

: WOOD WALL PANEL Sample Name Sample Number : SHCCM160200536

**Test Required** : To determine the flame spread index (FSI) and smoke-developed index (SDI) of

> the sample's surface burning characteristics when it is subjected to the conditions of specified in ASTM E84-14 "Standard Test Method for Surface

Burning Characteristics of Building Materials"

Buyer : HOMEDEPOT Date of Receipt : Feb. 18, 2016

Test Period : Feb. 18, 2016 to Mar. 11, 2016

Test result(s) : For further details, please refer to the following page(s)

\*\*\*\*\*\*\* To be continued\*\*\*\*\*\*

Signed for SGS-CSTC Standards Technical Services (Shanghai) Co., Ltd.

Erin Huang

Authorized signatory





No.: SHCCM160200536

Date: Mar. 11, 2016

Page: 2 of 6

#### I. TEST CONDUCTED

This test was conducted in accordance with ASTM E84-14 Standard Test Method for Surface Burning Characteristics of Building Materials.

#### II. INTRODUCTION

The method, designated as ASTM E84-14, "Standard Method of Test for Surface Burning Characteristics of Building Materials", is designed to determine the relative surface burning characteristics of materials under specific test conditions. Results are expressed in terms of flame spread index (FSI) and smoke developed index (SDI).

The purpose of this test method is to determine the relative burning behavior of the material by observing the flame spread along the specimen. Flame spread and smoke developed index are reported. However, there is not necessarily a relationship between these two measurements.

#### III. TEST PROCEDURE

The tunnel is preheated to 150°F, as measured by the floor-embedded thermocouple located 23.25 feet downstream of the burner ports, and allowed to cool to 105°F, as measured by the floor-embedded thermocouple located 13 feet from the burners. At this time the tunnel lid is raised and the test sample is placed along the ledges of the tunnel so as to form a continuous ceiling 24 feet long, 12 inches above the floor. The lid is then lowered into place.

Upon ignition of the gas burners, the flame spread distance is observed and recorded every 15 seconds. Flame spread distance versus time is plotted ignoring any flame front recessions. If the area under the curve (A) is less than or equal to 97.5 min·ft, FSI = 0.515·A; if greater, FSI = 4900/(195-A). Smoke developed is determined by comparing the area under the obscuration curve for the test sample to that of inorganic reinforced cement board and red oak, arbitrarily established as 0 and 100, respectively.

#### IV. CONDITIONING

Prior to testing, the sample was conditioned, to a constant weight at a temperature of 73.4±5°F (23±2.8°C) and at a relative humidity of 50±5%

\*\*\*\*\*\* To be continued\*\*\*\*\*\*





SHCCM160200536 No. :

Date: Mar. 11, 2016

Page: 3 of 6

#### V. SAMPLE DETAILS

Name	WOOD WALL PANEL
Color	Wood

Exposed face: The front face

#### **MOUNTING METHODS:**

The 20-gage, 2-in. (51-mm) hexagonal galvanized steel netting should span the width of the tunnel, then the specimen shall be placed on the netting.

The specimen consisted of 24 pieces of 127mm width×1120mm length× the normal thickness and 4pieces of 127mm wide x 1120mm long and all sections jointed end-to-end.

#### **TEST RESULTS**

FSI	SDI
35	400

#### RATING:

The National Fire Protection Association Life Safety Code 101, Chapter 10, Section 10.2.3 "Interior Wall and Ceiling Finish Classification", has a means of classifying materials with respect to Flame Spread and Smoke Developed when tested in accordance with NFPA 255, ASTM E84, UL 723 "Method of Test of Surface Burning Characteristics of Building Materials".

International Building Code, Chapter 8, Interior Finishes, Section 803 "Wall and Ceiling Finishes", was classified in accordance with ASTM E 84 or UL 723. Such interior finish materials shall be grouped in the following classes in accordance with their flame spread and smoke-developed indexes.

\*\*\*\*\*\* To be continued\*\*\*\*\*\*





No.: SHCCM160200536

Date: Mar. 11, 2016

Page: 4 of 6

### The classifications are as follows:


	Class A	Class B	Class C
Flame Spread Index	0-25	26-75	76-200
Smoke-developed Index	0-450	0-450	0-450

Since the tested sample received a Flame Spread Index 35 and a Smoke Developed 400, it would meet the requirement of Class B interior Wall & Ceiling Finish Category.

#### **OBSERVATIONS**

Time to ignition (sec)	29
Time to Max. FS (sec)	129
Maximum FS (feet)	8

### **GRAPHICAL RESULTS:**

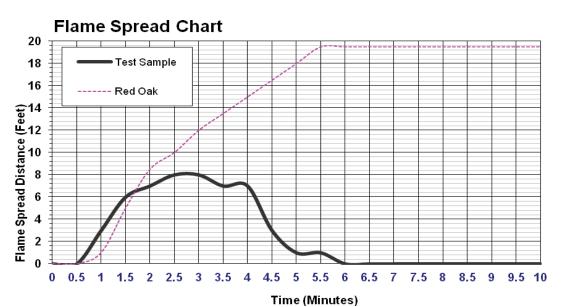



Inless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printer by overleaf, available on request or accessible at http://www.ngc.com/en/Terms-and-Conditions.aspx.and, for electronic format documents subject to Terms and Conditions for Electronic Documents at <a href="http://www.ngc.com/en/Terms-and-Conditions/Terms-e-Document.aspx">http://www.ngc.com/en/Terms-and-Conditions/Terms-e-Document.aspx</a> statement is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is divised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of client and this document does not expensate parties to a ransaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law, Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

\*\*Methods: To check the autherbicity of testing /inspection reports certificate, please contact us at telephone. (86-755) 83071443.

No.69, Block 1153, East Kang Dian Road, Pudong District, Shanghai, China. 201319 t(86-21) 61196300 f(86-21) 61191853 /68183920 www.sgsgroup.com.cn 中国·上海·浦东康桥东路1159弄69号 邮编: 201319 t(86-21) 61196300 f(86-21) 61191853 /68183920 e sgs.china@sgs.com



No.: SHCCM160200536

Date: Mar. 11, 2016

Page: 5 of 6

## **Smoke Developed Chart**

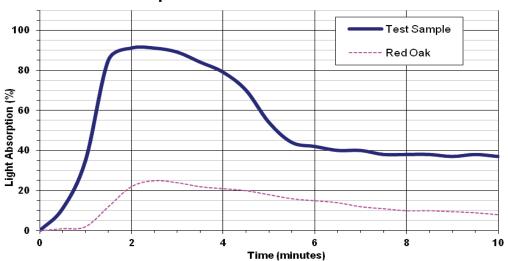


Figure 2 Smoke Developed Chart

### WARNING:

The use of supporting materials on the underside of the test specimen has the ability to lower the flame spread index from those which might be obtained if the specimen could be tested without such support. These test results do not necessarily relate to indices obtained by testing materials without such support. Testing of materials that melt, drip, or delaminate to such a degree that the continuity of the flame front is destroyed, results in low flame spread indices that do not relate directly to indices obtained by testing materials that remain in place.

The test results relate only to the specimens of the product in the form in which were tested. Small differences in the composition or thickness of the product may significantly affect the performance during the test and may therefore invalidate the test results. Care should be taken to ensure that any product, which is supplied or used, is fully represented by the specimens, which were tested.

The specimen was supplied by the sponsor and SGS-CSTC lab was not involved in any selection or sampling procedure.

\*\*\*\*\*\*\* To be continued\*\*\*\*\*\*





No. : SHCCM160200536

Date: Mar. 11, 2016

Page: 6 of 6

Note: The test was performed by SGS other internal laboratory.

Statement: Unless otherwise stated the results shown in this test report refer only to the sample(s) tested.

## Sample photo:



\*\*\*\*\*\* End of report \*\*\*\*\*\*

